

Model 102B11

Cryogenic ICP pressure sensor, 1000 psi, 5 mV/psi, 3/8-24 mtg thd, ground isolated with lockwire hole on clamp nut and outer adaptor

Installation and Operating Manual

For assistance with the operation of this product, contact the PCB Piezotronics, Inc.

Toll-free: 716-684-0001 24-hour SensorLine: 716-684-0001 Fax: 716-684-0987 E-mail: info@pcb.com Web: www.pcb.com







Repair and Maintenance

PCB guarantees Total Customer Satisfaction through its "Lifetime Warranty Plus" on all Platinum Stock Products sold by PCB and through its limited warranties on all other PCB Stock, Standard and Special products. Due to the sophisticated nature of our sensors and associated instrumentation, field servicing and repair is not recommended and, if attempted, will void the factory warranty.

Beyond routine calibration and battery replacements where applicable, our products require no user maintenance. Clean electrical connectors, housings, and mounting surfaces with solutions and techniques that will not harm the material of construction. Observe caution when using liquids near devices that are not hermetically sealed. Such devices should only be wiped with a dampened cloth—never saturated or submerged.

In the event that equipment becomes damaged or ceases to operate, our Application Engineers are here to support your troubleshooting efforts 24 hours a day, 7 days a week. Call or email with model and serial number as well as a brief description of the problem.

Calibration

Routine calibration of sensors and associated instrumentation is necessary to maintain measurement accuracy. We recommend calibrating on an annual basis, after exposure to any extreme environmental influence, or prior to any critical test.

PCB Piezotronics is an ISO-9001 certified company whose calibration services are accredited by A2LA to ISO/IEC 17025, with full traceability to SI through N.I.S.T. In addition to our standard calibration services, we also offer specialized tests, including: sensitivity at elevated or cryogenic temperatures, phase response, extended high or low frequency response, extended range, leak testing, hydrostatic pressure testing, and others. For more information, contact your local PCB Piezotronics distributor, sales representative, or factory customer service representative.

Returning Equipment

If factory repair is required, our representatives will provide you with a Return Material Authorization (RMA) number, which we use to reference any information you have already provided and expedite the repair process. This number should be clearly marked on the outside of all returned package(s) and on any packing list(s) accompanying the shipment.

Contact Information

PCB Piezotronics, Inc. 3425 Walden Ave. Depew, NY14043 USA Toll-free: (800) 828-8840 24-hour SensorLine: (716) 684-0001 General inquiries: <u>info@pcb.com</u> Repair inquiries: <u>rma@pcb.com</u>

For a complete list of distributors, global offices and sales representatives, visit our website, <u>www.pcb.com</u>.

Safety Considerations

This product is intended for use by qualified personnel who recognize shock hazards and are familiar with the precautions required to avoid injury. While our equipment is designed with user safety in mind, the protection provided by the equipment may be impaired if equipment is used in a manner not specified by this manual.

Discontinue use and contact our 24-Hour Sensorline if:

- Assistance is needed to safely operate equipment
- Damage is visible or suspected
- Equipment fails or malfunctions

For complete equipment ratings, refer to the enclosed specification sheet for your product.

Definition of Terms and Symbols

The following symbols may be used in this manual:



DANGER

Indicates an immediate hazardous situation, which, if not avoided, may result in death or serious injury.



CAUTION

Refers to hazards that could damage the instrument.



NOTE

Indicates tips, recommendations and important information. The notes simplify processes and contain additional information on particular operating steps.

The following symbols may be found on the equipment described in this manual:



This symbol on the unit indicates that high voltage may be present. Use standard safety precautions to avoid personal contact with this voltage.



This symbol on the unit indicates that the user should refer to the operating instructions located in the manual.



This symbol indicates safety, earth ground.



PCB工业监视和测量设备 - 中国RoHS2公布表 PCB Industrial Monitoring and Measuring Equipment - China RoHS 2 Disclosure Table

	有害物 质									
部件名称	铅 (Pb)	汞 (Hg)	镉 (Cd)	六价铬 (Cr(VI))	多溴 联苯 (PBB)					
住房	0	0	0	0	0	0				
PCB板	Х	0	0	0	0	0				
电气连接 器	0	0	0	0	0	0				
压电晶 体	х	0	0	0	0	0				
环氧	0	0	0	0	0	0				
铁氟龙	0	0	0	0	0	0				
电子	0	0	0	0	0	0				
厚膜基板	0	0	Х	0	0	0				
电线	0	0	0	0	0	0				
电缆	Х	0	0	0	0	0				
塑料	0	0	0	0	0	0				
焊接	Х	0	0	0	0	0				
铜合金 /黄 铜	Х	0	0	0	0	0				
本表格依据 SJ/T 1	L 1364 的 规定	编制。								
0: 表示 该有害物	勿质在该部件	所有均同	気材料中	的含量均在 GB/T 26	572 规定的限量要求以	下 ₀				
				材料中的含量超出(3目前由于允许的豁	6B/T 26572 规定的限量 免。	要求。				

CHINA ROHS COMPLIANCE

Component Name	Hazardous Substances									
	Lead (Pb)	Mercury (Hg)	Cadmium (Cd)	Chromium VI Compounds (Cr(VI))	Polybrominated Biphenyls (PBB)	Polybrominated Diphenyl Ethers (PBDE)				
Housing	0	0	0	0	0	0				
PCB Board	Х	0	0	0	0	0				
Electrical Connectors	0	0	0	0	0	0				
Piezoelectric Crystals	Х	0	0	0	0	0				
Ероху	0	0	0	0	0	0				
Teflon	0	0	0	0	0	0				
Electronics	0	0	0	0	0	0				
Thick Film Substrate	0	0	Х	0	0	0				
Wires	0	0	0	0	0	0				
Cables	Х	0	0	0	0	0				
Plastic	0	0	0	0	0	0				
Solder	Х	0	0	0	0	0				
Copper Alloy/Brass	Х	0	0	0	0	0				

This table is prepared in accordance with the provisions of SJ/T 11364.

O: Indicates that said hazardous substance contained in all of the homogeneous materials for this part is below the limit requirement of GB/T 26572.

X: Indicates that said hazardous substance contained in at least one of the homogeneous materials for this part is above the limit requirement of GB/T 26572.

Lead is present due to allowed exemption in Annex III or Annex IV of the European RoHS Directive 2011/65/EU.

1.0 DESCRIPTION


This sensor series consists of a Model 112A quartz pressure element coupled to a special MOSFET amplifier circuit to permit operation at cryogenic temperatures.

Cryogenic sensors use special electronics that have some characteristics differing from standard designs.

Polarity of the output signal is positive-going for increasing pressure.

2.0 INSTALLATION

Refer to installation drawing for mounting hole preparation. The outer housing of the thread adaptor is ground isolated from the sensing element.

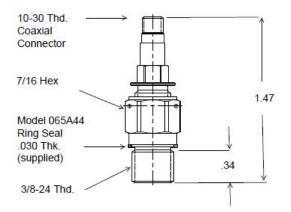

Series 102B10: Cryogenic Pressure Sensor

Prepare mounting ports in accordance with the installation drawing for the specific model, paying particular attention to sealing surfaces. These surfaces must be smooth and free from chatter marks, nicks and other irregularities which could prevent a pressure-tight seal.

Seals are provided with each sensor and should always be used. Extra seals for all standard models are in stock at the factory. It is recommended to replace the seals every time the sensor is re-installed. Although these low-impedance sensors are not affected by moisture, in extreme environments such as cryogenic, it is advisable to protect cable connections with shrink tubing. Low-noise cable

(003A) is not necessary. Model 070A09 solder connector adaptor permits the use of ordinary two-wire cable.

3.0 OPERATION

These sensors are operated like standard ICP[®] sensors.

For general laboratory-type use, either Model 480C02 battery-powered signal conditioner or Model 482A06 line-powered signal conditioner is recommended for use with Cryogenic Sensors. Both Models provide 2 mA constant current to power the sensor electronics.

Other standard signal conditioners Series 481A, 482A, and 483A may also be used, provided the current is adjusted to 2 mA. All above Models include a bias de-coupling capacitor in series with the output connector.

For telemetry applications, Model 495A signal conditioner provides band pass filtering, adjustable gain, bias and limiting.

4.0 CALIBRATION

Because of the relatively short time constants of these sensors (see specification sheet at the front of this manual), only dynamic calibration methods can be used.

5.0 MAINTENANCE

Because of the miniature size and built-in electronics of these units, field maintenance is not recommended.

OPERATING GUIDE DYNAMIC (CRYOGENIC) ICP[®] PRESSURE SENSORS MODELS 102B10, B11, B13, B14

6.0 CAUTION

The FET amplifier used in these sensors is a special low-noise device with gate breakdown voltage of 125 volts.

This voltage rating can be exceeded by either imposing a high-pressure step or a fast-rising pressure ramp to the diaphragm in excess of the rating for the sensor.

Slowly applied or released static pressure levels, within the mechanical capability of the sensor, are not dangerous since the charge generated by the quartz element has time to leak off through the FET bias resistor.

It is important to note that the following two pressure ratings are involved:

1. Maximum total pressure (mechanical consideration).

2. Maximum step pressure (electrical consideration).

NOTE: To avoid damage to the sensor, limit pressure application to maximum values on specification sheet at the front of this manual.

The maximum step pressure may be exceeded up to the maximum total pressure level provided the total pressure (rise or fall) takes place.

® ICP is a registered trademark of PCB Piezotronics

Model Number 102B11		ICP® P	RESSUR	RE SENSOR				evision: C CN #: 51804
erformance	ENGLISH	SI			OF	TIONAL VERSION		
easurement Range(for ±5V output)	1 kpsi	6,895 kPa		Optional versions h	nave identical specific	ations and accessori	es as listed for the sta	ndard model exc
eful Overrange(for \pm 10V output)	2,000 psi	13,790 kPa	[1]		where noted belo	ow. More than one o	ption may be used.	
nsitivity	5.0 mV/psi	0.725 mV/kPa	1.1	M - Metric Mour	nt			
aximum Pressure(step)	10,000 psi	69,000 kPa		Optional Accesso	ory: Model 065A34 Se	eal ring 0.435" OD x 0).397" ID x 0.030" Cu (3)
aximum Pressure(Total)	15 kpsi	103,425 kPa	[2]					
solution	20 mpsi	0.138 kPa						
sonant Frequency	≥ 250 kHz	≥ 250 kHz						
e Time(Reflected)	≤ 2.0 µ sec	≤ 2.0 µ sec						
w Frequency Response(- 5 %)	0.25 Hz	0.25 Hz	[2]					
on-Linearity I vironmental	≤ 1.0 % FS	≤ 1.0 % FS	[3]					
celeration Sensitivity	≤ 0.002 psi/g	$\leq 0.0014 \text{kPa}/(\text{m/s}^2)$						
mperature Range(Operating)	-320 to +212 °F	-196 to +100 °C						
mperature Coefficient of Sensitivity	≤ 0.06 %/°F	≤ 0.108 %/°C						
aximum Shock	20,000 g pk	196,133 m/s ² pk						
ectrical								
Itput Polarity(Positive Pressure)	Positive	Positive						
scharge Time Constant(at room temp)	≥ 2.0 sec	≥ 2.0 sec						
citation Voltage	20 to 30 VDC	20 to 30 VDC						
Instant Current Excitation	2 to 20 mA	2 to 20 mA						
itput Impedance Itput Bias Voltage	< 100 Ohm 9 to 13 VDC	< 100 Ohm 9 to 13 VDC						
nysical	3 to 13 VDC	5 10 13 VDC						
nsing Element	Quartz	Quartz						
busing Material	304L/316L Stainless Steel	304L/316L Stainless Steel	I					
read Adaptor Material	316L Stainless Steel	316L Stainless Steel						
aphragm	316L Stainless Steel	316L Stainless Steel						
aling	Welded Hermetic	Welded Hermetic						
ectrical Connector eight	10-32 Coaxial Jack .388 oz	10-32 Coaxial Jack 11.00 gm						
-		-						
- <u>C</u>				[2]Due to high se prevent more the (approximately 1 [3]Zero-based, le [4]See PCB Decla	an 10 Volt change in 6 5 times discharge tin east-squares, straigh aration of Conformar	essure should be app output until Output E ne constant). t line method. Ice PS023 for details		
• [4]				Entered: RB Date: 06/18/2021	Engineer: MP Date: 06/18/2021	Sales: MV Date: 06/18/2021	Approved: RPF Date: 06/18/2021	Spec Number 70581
specifications are at room temperature	unless otherwise specified			3425 Walden Aver	PIEZOTRO	Fax: 716 E-Mail: in	16-684-0001 -684-0987 ifo@pcb.com	•



Model 061A01

Mounting adaptor, 3/8-24 external thd to 5/16-24 internal thd, 17-4 SS (for Series 111, 112 & 113)

Installation and Operating Manual

For assistance with the operation of this product, contact the PCB Piezotronics, Inc.

Toll-free: 716-684-0001 24-hour SensorLine: 716-684-0001 Fax: 716-684-0987 E-mail: info@pcb.com Web: www.pcb.com







Repair and Maintenance

PCB guarantees Total Customer Satisfaction through its "Lifetime Warranty Plus" on all Platinum Stock Products sold by PCB and through its limited warranties on all other PCB Stock, Standard and Special products. Due to the sophisticated nature of our sensors and associated instrumentation, field servicing and repair is not recommended and, if attempted, will void the factory warranty.

Beyond routine calibration and battery replacements where applicable, our products require no user maintenance. Clean electrical connectors, housings, and mounting surfaces with solutions and techniques that will not harm the material of construction. Observe caution when using liquids near devices that are not hermetically sealed. Such devices should only be wiped with a dampened cloth—never saturated or submerged.

In the event that equipment becomes damaged or ceases to operate, our Application Engineers are here to support your troubleshooting efforts 24 hours a day, 7 days a week. Call or email with model and serial number as well as a brief description of the problem.

Calibration

Routine calibration of sensors and associated instrumentation is necessary to maintain measurement accuracy. We recommend calibrating on an annual basis, after exposure to any extreme environmental influence, or prior to any critical test.

PCB Piezotronics is an ISO-9001 certified company whose calibration services are accredited by A2LA to ISO/IEC 17025, with full traceability to SI through N.I.S.T. In addition to our standard calibration services, we also offer specialized tests, including: sensitivity at elevated or cryogenic temperatures, phase response, extended high or low frequency response, extended range, leak testing, hydrostatic pressure testing, and others. For more information, contact your local PCB Piezotronics distributor, sales representative, or factory customer service representative.

Returning Equipment

If factory repair is required, our representatives will provide you with a Return Material Authorization (RMA) number, which we use to reference any information you have already provided and expedite the repair process. This number should be clearly marked on the outside of all returned package(s) and on any packing list(s) accompanying the shipment.

Contact Information

PCB Piezotronics, Inc. 3425 Walden Ave. Depew, NY14043 USA Toll-free: (800) 828-8840 24-hour SensorLine: (716) 684-0001 General inquiries: <u>info@pcb.com</u> Repair inquiries: <u>rma@pcb.com</u>

For a complete list of distributors, global offices and sales representatives, visit our website, <u>www.pcb.com</u>.

Safety Considerations

This product is intended for use by qualified personnel who recognize shock hazards and are familiar with the precautions required to avoid injury. While our equipment is designed with user safety in mind, the protection provided by the equipment may be impaired if equipment is used in a manner not specified by this manual.

Discontinue use and contact our 24-Hour Sensorline if:

- Assistance is needed to safely operate equipment
- Damage is visible or suspected
- Equipment fails or malfunctions

For complete equipment ratings, refer to the enclosed specification sheet for your product.

Definition of Terms and Symbols

The following symbols may be used in this manual:



DANGER

Indicates an immediate hazardous situation, which, if not avoided, may result in death or serious injury.



CAUTION

Refers to hazards that could damage the instrument.



NOTE

Indicates tips, recommendations and important information. The notes simplify processes and contain additional information on particular operating steps.

The following symbols may be found on the equipment described in this manual:



This symbol on the unit indicates that high voltage may be present. Use standard safety precautions to avoid personal contact with this voltage.



This symbol on the unit indicates that the user should refer to the operating instructions located in the manual.



This symbol indicates safety, earth ground.



PCB工业监视和测量设备 - 中国RoHS2公布表 PCB Industrial Monitoring and Measuring Equipment - China RoHS 2 Disclosure Table

	有害物 质									
部件名称	铅 (Pb)	汞 (Hg)	镉 (Cd)	六价铬 (Cr(VI))	多溴 联苯 (PBB)					
住房	0	0	0	0	0	0				
PCB板	Х	0	0	0	0	0				
电气连接 器	0	0	0	0	0	0				
压电晶 体	х	0	0	0	0	0				
环氧	0	0	0	0	0	0				
铁氟龙	0	0	0	0	0	0				
电子	0	0	0	0	0	0				
厚膜基板	0	0	Х	0	0	0				
电线	0	0	0	0	0	0				
电缆	Х	0	0	0	0	0				
塑料	0	0	0	0	0	0				
焊接	Х	0	0	0	0	0				
铜合金 /黄 铜	Х	0	0	0	0	0				
本表格依据 SJ/T 1	L 1364 的 规定	编制。								
0: 表示 该有害物	勿质在该部件	所有均同	気材料中	的含量均在 GB/T 26	572 规定的限量要求以	下 ₀				
				材料中的含量超出(3目前由于允许的豁	6B/T 26572 规定的限量 免。	要求。				

CHINA ROHS COMPLIANCE


Component Name	Hazardous Substances									
	Lead (Pb)	Mercury (Hg)	Cadmium (Cd)	Chromium VI Compounds (Cr(VI))	Polybrominated Biphenyls (PBB)	Polybrominated Diphenyl Ethers (PBDE)				
Housing	0	0	0	0	0	0				
PCB Board	Х	0	0	0	0	0				
Electrical Connectors	0	0	0	0	0	0				
Piezoelectric Crystals	Х	0	0	0	0	0				
Ероху	0	0	0	0	0	0				
Teflon	0	0	0	0	0	0				
Electronics	0	0	0	0	0	0				
Thick Film Substrate	0	0	Х	0	0	0				
Wires	0	0	0	0	0	0				
Cables	Х	0	0	0	0	0				
Plastic	0	0	0	0	0	0				
Solder	Х	0	0	0	0	0				
Copper Alloy/Brass	Х	0	0	0	0	0				

This table is prepared in accordance with the provisions of SJ/T 11364.

O: Indicates that said hazardous substance contained in all of the homogeneous materials for this part is below the limit requirement of GB/T 26572.

X: Indicates that said hazardous substance contained in at least one of the homogeneous materials for this part is above the limit requirement of GB/T 26572.

Lead is present due to allowed exemption in Annex III or Annex IV of the European RoHS Directive 2011/65/EU.

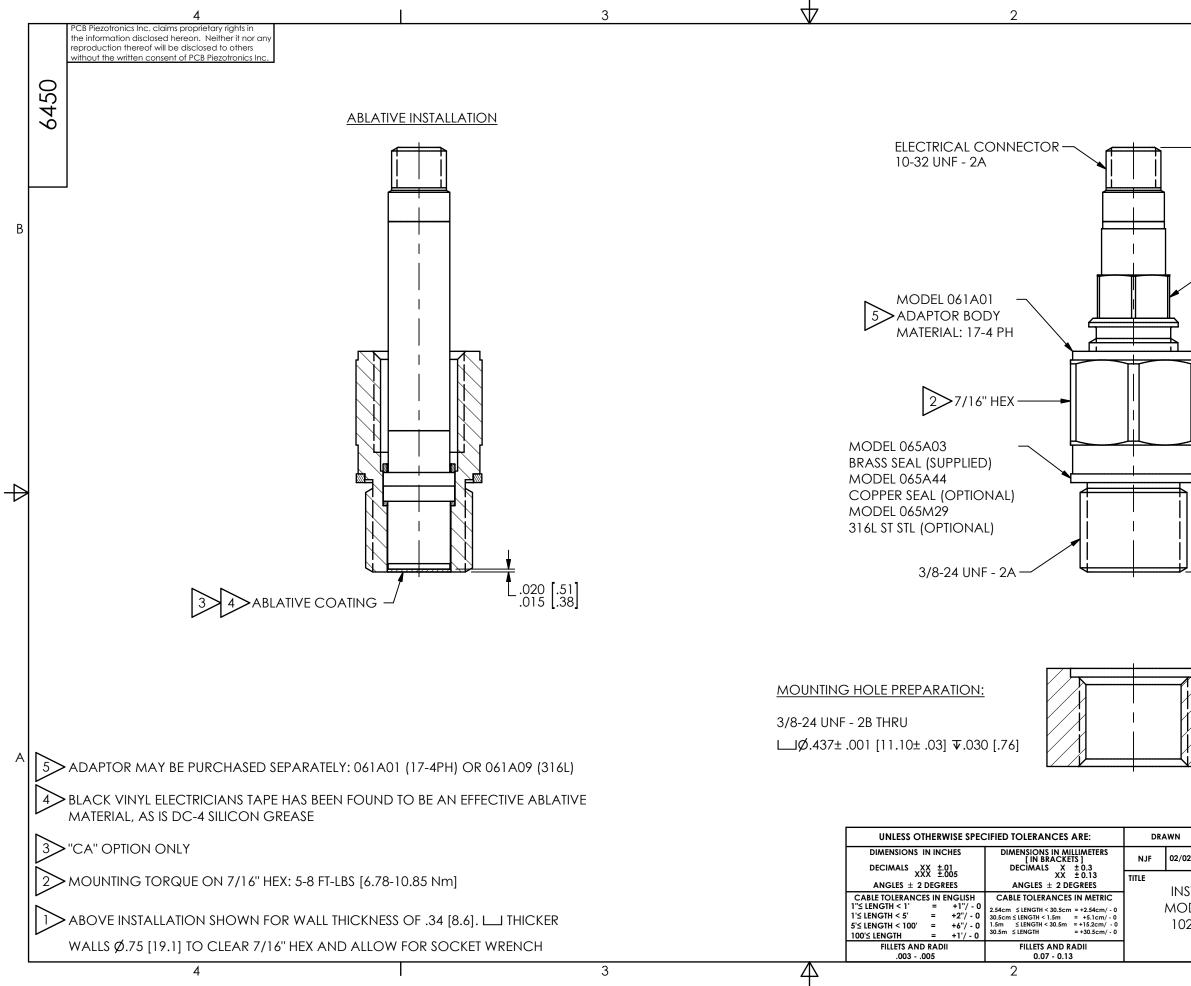

	I					1			
	Γ			F					1
	REV			DES	CRIPTION			DIN	1
	G			UPDA	TED NOTE	S		54569]
	- MOI CLA	DEL 060 .MP NU1	CHAI	LE RGE P®	NGTH 1.33±.0 1.47±.0	5 [33.8]			в
		ECKED	.6]]		[®]P 0	B PIE	ZOTR	ONICS	A
02/24	JDW	02/02/24	MJB (02/02/24				NOL COMPANY	
STAI		N DRA	WING				VE. DEPEW	, NY 14043 s@pcb.com	
DEL	S 101	A, 102A	, 102B,		CODE	SHEET	DWG. NO.		1
		01, & 0			IDENT. NO. 52681	В	64	450	
PR	ESSUR	E SENSO	OR		SCALE:	3X	SHEET	1 OF 1	1
	_								



Model 102B11

Cryogenic ICP pressure sensor, 1000 psi, 5 mV/psi, 3/8-24 mtg thd, ground isolated with lockwire hole on clamp nut and outer adaptor

Installation and Operating Manual

For assistance with the operation of this product, contact the PCB Piezotronics, Inc.

Toll-free: 716-684-0001 24-hour SensorLine: 716-684-0001 Fax: 716-684-0987 E-mail: info@pcb.com Web: www.pcb.com







Repair and Maintenance

PCB guarantees Total Customer Satisfaction through its "Lifetime Warranty Plus" on all Platinum Stock Products sold by PCB and through its limited warranties on all other PCB Stock, Standard and Special products. Due to the sophisticated nature of our sensors and associated instrumentation, field servicing and repair is not recommended and, if attempted, will void the factory warranty.

Beyond routine calibration and battery replacements where applicable, our products require no user maintenance. Clean electrical connectors, housings, and mounting surfaces with solutions and techniques that will not harm the material of construction. Observe caution when using liquids near devices that are not hermetically sealed. Such devices should only be wiped with a dampened cloth—never saturated or submerged.

In the event that equipment becomes damaged or ceases to operate, our Application Engineers are here to support your troubleshooting efforts 24 hours a day, 7 days a week. Call or email with model and serial number as well as a brief description of the problem.

Calibration

Routine calibration of sensors and associated instrumentation is necessary to maintain measurement accuracy. We recommend calibrating on an annual basis, after exposure to any extreme environmental influence, or prior to any critical test.

PCB Piezotronics is an ISO-9001 certified company whose calibration services are accredited by A2LA to ISO/IEC 17025, with full traceability to SI through N.I.S.T. In addition to our standard calibration services, we also offer specialized tests, including: sensitivity at elevated or cryogenic temperatures, phase response, extended high or low frequency response, extended range, leak testing, hydrostatic pressure testing, and others. For more information, contact your local PCB Piezotronics distributor, sales representative, or factory customer service representative.

Returning Equipment

If factory repair is required, our representatives will provide you with a Return Material Authorization (RMA) number, which we use to reference any information you have already provided and expedite the repair process. This number should be clearly marked on the outside of all returned package(s) and on any packing list(s) accompanying the shipment.

Contact Information

PCB Piezotronics, Inc. 3425 Walden Ave. Depew, NY14043 USA Toll-free: (800) 828-8840 24-hour SensorLine: (716) 684-0001 General inquiries: <u>info@pcb.com</u> Repair inquiries: <u>rma@pcb.com</u>

For a complete list of distributors, global offices and sales representatives, visit our website, <u>www.pcb.com</u>.

Safety Considerations

This product is intended for use by qualified personnel who recognize shock hazards and are familiar with the precautions required to avoid injury. While our equipment is designed with user safety in mind, the protection provided by the equipment may be impaired if equipment is used in a manner not specified by this manual.

Discontinue use and contact our 24-Hour Sensorline if:

- Assistance is needed to safely operate equipment
- Damage is visible or suspected
- Equipment fails or malfunctions

For complete equipment ratings, refer to the enclosed specification sheet for your product.

Definition of Terms and Symbols

The following symbols may be used in this manual:



DANGER

Indicates an immediate hazardous situation, which, if not avoided, may result in death or serious injury.



CAUTION

Refers to hazards that could damage the instrument.



NOTE

Indicates tips, recommendations and important information. The notes simplify processes and contain additional information on particular operating steps.

The following symbols may be found on the equipment described in this manual:



This symbol on the unit indicates that high voltage may be present. Use standard safety precautions to avoid personal contact with this voltage.



This symbol on the unit indicates that the user should refer to the operating instructions located in the manual.



This symbol indicates safety, earth ground.



PCB工业监视和测量设备 - 中国RoHS2公布表 PCB Industrial Monitoring and Measuring Equipment - China RoHS 2 Disclosure Table

	有害物 质									
部件名称	铅 (Pb)	汞 (Hg)	镉 (Cd)	六价铬 (Cr(VI))	多溴 联苯 (PBB)					
住房	0	0	0	0	0	0				
PCB板	Х	0	0	0	0	0				
电气连接 器	0	0	0	0	0	0				
压电晶 体	х	0	0	0	0	0				
环氧	0	0	0	0	0	0				
铁氟龙	0	0	0	0	0	0				
电子	0	0	0	0	0	0				
厚膜基板	0	0	Х	0	0	0				
电线	0	0	0	0	0	0				
电缆	Х	0	0	0	0	0				
塑料	0	0	0	0	0	0				
焊接	Х	0	0	0	0	0				
铜合金 /黄 铜	Х	0	0	0	0	0				
本表格依据 SJ/T 1	L 1364 的 规定	编制。								
0: 表示 该有害物	勿质在该部件	所有均同	気材料中	的含量均在 GB/T 26	572 规定的限量要求以	下 ₀				
				材料中的含量超出(3目前由于允许的豁	6B/T 26572 规定的限量 免。	要求。				

CHINA ROHS COMPLIANCE


Component Name	Hazardous Substances									
	Lead (Pb)	Mercury (Hg)	Cadmium (Cd)	Chromium VI Compounds (Cr(VI))	Polybrominated Biphenyls (PBB)	Polybrominated Diphenyl Ethers (PBDE)				
Housing	0	0	0	0	0	0				
PCB Board	Х	0	0	0	0	0				
Electrical Connectors	0	0	0	0	0	0				
Piezoelectric Crystals	Х	0	0	0	0	0				
Ероху	0	0	0	0	0	0				
Teflon	0	0	0	0	0	0				
Electronics	0	0	0	0	0	0				
Thick Film Substrate	0	0	Х	0	0	0				
Wires	0	0	0	0	0	0				
Cables	Х	0	0	0	0	0				
Plastic	0	0	0	0	0	0				
Solder	Х	0	0	0	0	0				
Copper Alloy/Brass	Х	0	0	0	0	0				

This table is prepared in accordance with the provisions of SJ/T 11364.

O: Indicates that said hazardous substance contained in all of the homogeneous materials for this part is below the limit requirement of GB/T 26572.

X: Indicates that said hazardous substance contained in at least one of the homogeneous materials for this part is above the limit requirement of GB/T 26572.

Lead is present due to allowed exemption in Annex III or Annex IV of the European RoHS Directive 2011/65/EU.

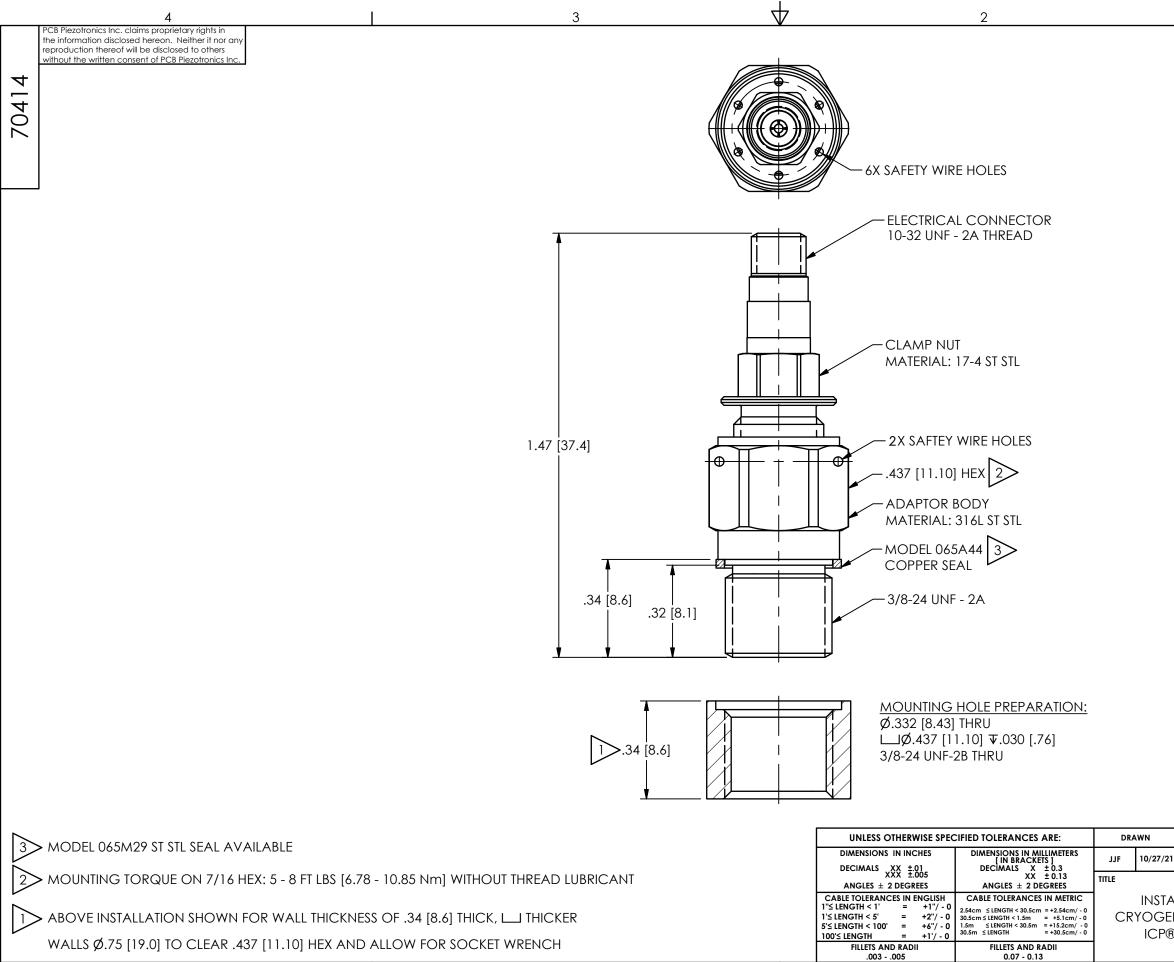

 \rightarrow

4

3

4

2

]	
	REVISIONS	
REV	DESCRIPTION	DIN
А	UPDATED TORQUE NOTE	52229

В

 \blacksquare

ENGINEER CHECKED PCB PIEZOTRONICS MJP 10/27/21 JJF 10/27/21 AN AMPHENOL COMPANY 3425 WALDEN AVE. DEPEW, NY 14043 (716) 684-0001 E-MAIL: sales@pcb.com INSTALLATION DRAWING CODE DWG. NO. CRYOGENIC GROUND ISOLATED 70414 IDENT. NO. ICP® PRESSURE SENSOR 52681 SCALE: 3X SHEET 1 OF 1